

Manhole Inspection Summary

Manhole # S61S__003MH

Printed On: 9/17/2009

Page 1 of 4

Inspection ☐ Is Incomplete Rating: **3) Fair**

Record Plat: **61S** Node: **003** Status: **Found**

Insp Date: **11/24/08 2:06 PM**

Incomplete Comments

Crew: **DJ, BR**
Inspector: **MikeMixer**
Firm: **RJN**

Location Address: **1600 Ponca St.**

Cross Street: **none**

Manhole Type: **Inline** Location: **Roadway** Ground Conditions: **Dry**

☐ Prev. Rehab Weather: **Dry** Subject To Ponding: **None**

Comments **CITY OPENED MANHOLE. 7/21/08. INSPECTED 11/24/2008. MANHOLE WALL SUGGEST A LINER TO STOP INFILTRATION. MAP SHOWS O12 IS 30". INSPECTION MEASURED IT AT 27".**

Cover Shape: **Circular** Diameter: **30** (in.) Length: (in.) Dist A/B Grade: **0** (in.)

Type: **Sanitary** Condition: **Sound** Cover Material: **Cast Iron**

Properties: ☒ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

Frame Offset: **0** (in.) Condition: ☒ Sound ☐ Cracked ☐ Leaks

Chimney / Frame Adjustment ☐ Exists Material: ☐ Parged Height: (in.)

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Corbel Material: **Brick** ☒ Parged Type: **Concentric/Eccentric**

Condition: ☐ Sound ☒ **Cracked** ☐ Root Intrusion ☐ Loose Brick ☒ **Deteriorated**

Infiltration: ☐ None ☒ **Joint** ☒ **Cracks** ☒ **Mortar** ☐ Roots ☒ **Wall**

Barrel Material: **Brick** ☒ Parged

Shape: **Circular** Diameter: **48** (in.) Length: (in.)

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☒ **Deteriorated**

Infiltration: ☐ None ☒ **Joint** ☒ **Cracks** ☒ **Mortar** ☐ Roots ☒ **Wall**

Bench ☒ Exists Material: **Brick** ☐ Parged

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☒ **Deteriorated** ☒ **Leaks** ☐ Debris

Channel Material: **Brick** ☐ Parged

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth:

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☒ **Deteriorated** ☒ **Leaks** ☒ **Debris**

Steps Count: **10** Missing: **0** ☐ Corroded

Surcharge ☐ Evidence Of Surcharge Depth: (ft.) ☐ Active Surcharge Present

Location View



Top View




This is oriented the right way. There is a pipe in at 10 o'clock

Old plugged service line



old line plugged. Encrustation around old plugged line

Defect 1

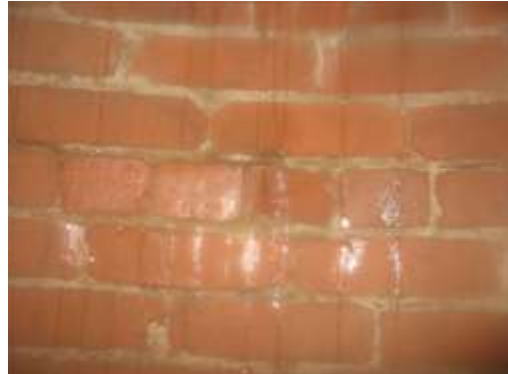

Leaking walls from mortar and joint.

Defect 4



walls leaking

Manhole Inspection Summary

Manhole # S61S__003MH

Printed On: 9/17/2009

Page 3 of 4

27 in. Circular Gravity Sewer
Pipe Out @ 12 O'Clock

12 O'Clock Outflow



Pipe Height: **27.6** (in.) Rod and Bar (Angled)
Pipe Material: **Clay** ☐ Pipe Lined
Invert Depth: **18.75** (ft.) Flow Characteristics: **Slow**
Deposits: ☐ None ☐ Mud ☐ Sludge ☒ **Debris** ☐ Grease
Silt Depth: **0.25** (in.) Deposits Extent: **Light**
Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

27 in. Circular Gravity Sewer
Pipe In @ 6 O'Clock

6 O'Clock Inflow



Pipe Height: **27.6** (in.) Rod and Bar (Angled)
Pipe Material: **Clay** ☐ Pipe Lined
Invert Depth: **18.58** (ft.) Flow Characteristics: **Slow**
Deposits: ☐ None ☐ Mud ☐ Sludge ☒ **Debris** ☐ Grease
Silt Depth: **0.25** (in.) Deposits Extent: **Light**
Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

Manhole Inspection Summary

Manhole # S61S__003MH

Printed On: 9/17/2009

Page 4 of 4

8 in. Circular Gravity Sewer

10 O'Clock Inflow

Pipe In @ 10 O'Clock



Pipe Height: **8.4** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **16.35** (ft.) Flow Characteristics: **Slow**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection